


## ENGINE MAINTENANCE RECORDS

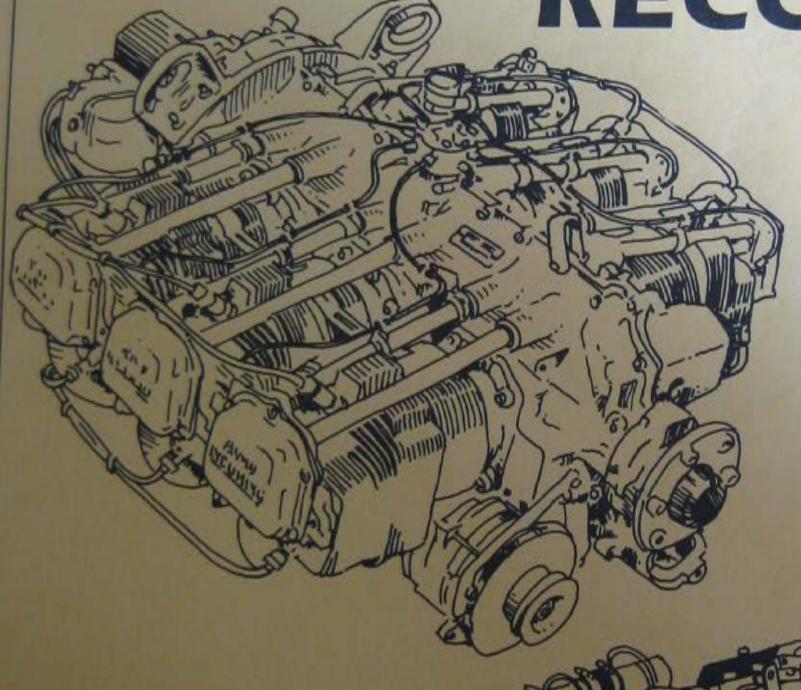



1-800 624-6680

(In NY 516-298-8330)

MATTITUCK AVIATION CORPORATION
410 AIRWAY DRIVE, MATTITUCK, NY 1.1952

## MATTITUCK AIRBASE, INC. / Limited Piston Engine Warranty

Effective 2/5/88, Mettituck Airbese, Inc., (hereinafter called "MAB"), makes the following warranty.

to the customer, subject to the limitations, conditions and exclusions set forth below.

WARRANTY COVERAGE - For a period of six (6) months after date of delivery to customer, or 240 hours of operation, whichever occurs first, MAB shall repair or replace, at its option, any aircraft engine, accessory, or part which is found to be defective, to MAB's satisfaction, within said warranty period.

For engine warranty after six (6) months from date of delivery to customer and prior to the expiration of the original manufacturer's recommended time between overhaut ("TBO"), the cost of repair or replacement (including the cost of parts and labor), at MARI's option, shall be prorated in the following manner. The runtomer shall pay the net price for a newly rebuilt engine equal to the current list price for the engine divided by the manufacturer's recommended TBO, and then multiplied by the number of hours on the repaired or replaced engine (which shall be deemed the greater of the actual logbook hours, recorded tachemeter hours or time at forty (40) hours per month from the date of delivery). Reasonable labor costs associated with the repair of a warrantoed engine shall be prorated in the same manner on the basis of a flat rate schedule established by MAti.

After the Inital six (6) months from date of delivery or 240 hours of operation, MAB will not assume eny responsibility for the repair or replacement of engine accessories, e.g. magnete, starter, alternator, ignition hamess, furbocharger, etc.

Replacement parts supplied for warranteed engines still covered by manufacturer's warranty are supplied on an exchange basis. MAR will pursue warranty claims with the manufacturer on the owner's becall. Any allowance by the manufacturer will be credited to the operator's account.

The repair or replacement of any part under the foregoing warranty shall not extend the periods of warranty coverage set form above. MAB reserves the right to change the price or specifications of any engine or part at any time.

CONDITIONS AND PROCEDURES FOR OBTAINING WARRANTY WORK. The foregoing warranty shall be effective only if the engine or component to be serviced is returned to MAB's facility at customer's expense, together with particulars in writing of the nature of the defect. The customer or his representative should contact MAB for verification and authorization of warranty prior to return and/or report. Written surhorization must be obtained from MAB before repairs covered by warranty can be

Wark Order No. 1014/4 Engine Serial No. 2-12393-516 performed other than by MAB. In no event shall allowable labor costs exceed local published shop rates. The foregoing warranty shall apply if and only if the engine has been properly installed and maintained in accordance with current approved standards of the FAA and current recommendations of the manufacturer as specified in applicable factory manuals and service bulletins. The performance of recommended inspections and maintenance must be documented by logbook entries which must accompany any engine returned for warranty work. Defects must be discovered within the warranty period and MAB must be given prompt notice thereof in writing, within ten (10) days after discovery.

transportation or delivery expenses, costs, or airframe repairs, all of which are excluded under this warranty. MAB does not warrant parts, materials or services supplied which are covered by manufacturer's warranty. This warranty shall not apply to any engine which has been subject to misuse, neglect, accident or damage from the elements, or which has been installed, repaired or maintained or aftered in any manner which, in the judgement of MAB, has had an adverse effect on the engine or part. This warranty shall not apply to any engine which has been repaired or maintained or aftered in any manner apply to any engine which has been repaired or altered in any manner other than by MAB, or its representative.

THE FOREGOING WARRANTY IS IN LIEU OF ALL OTHER WARRANTIES OR REPRESENT ATIONS, EXPRESS OR IMPLIED ARISING BY OPERATION OF LAW OR OTHERWISE, INCLUDING WITHOUT LIMITATION THE WARRANTY OR MERCHANTABILITY OR FITNESS FOR PARTICULAR PURPOSE WHICH WARRANTIES ARE HEREBY EXCLUDED. MAB Rability hereunder shall be limited to the repair or replacement of any engine or part found to be defective within the applicable warranty period as set forth above. IN NO EVENT SHALL MAB BE LIABLE FOR CONSEQUENTIAL OR INCIDENTAL DAMAGES OR ECONOMIC LOSS OF ANY NATURE WHETHER ARISING IN CONTRACT OR TORT, INCLUDING STRICT LIABILITY ON TORT OR NEGLIGENCE ON THE PART OF MAB. The foregoing limitations and exclusion with respect to implied warrantee and the exclusion of incidental or consequential damages may not apply in those states which prohibit such limitation or exclusions. This warranty gives customer specific legal rights, and the customer may have often rights which vary from state to state.



Mattituck, N.Y. 11952 Tal: (516) 298-8330

## ENGINE MAINTENANCE RECORDS

		L	og No
Aircraft Registration No	N 2193Q		
Engine Manufacturer	ycoming	4	
Model _ 10 - 360 A1	1860		
Serial No L - / 2393	3-51A		
Date installed on aircraft	2/29/92		
Time Between Overhauls	(TBO)	Hall	_Hours
	If used on multi-	engine aircr	aft:
	☐ Right ☐ Front	□ Left □ Rear	

	TOTAL	TOTAL TIME SINCE	TACH OR RECORDING METER	DESCRIPTION OF WORK SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
DATE	BERVICE	OVERHAUL	TIME	TOTALS brought forward from previous page
			0	and Inspection Total Time Engine 16499
4-10-	94	no L	10	Test TSMOIT 413
Perform	med di	74/	# 76/	#4 76/60 Tuch Time 1.3
*1 7	100 7	180	3 790	al Drained oil and replaced with 8 gts
Cleaned	all 500	wk ply	4 + 9 m	oed, with CFO 100.
Acosh 1	1 15 W.S	0 Eng	ne oil	Changed and Right Inspectal
Checker	mag	Fining	25°B	Il II Alle holy Screen, Clean, Cleaned
Starte	Brusha	OK.	Insper	ted thentone way
fulin	uters.	CWA	0 93-9	2-05 (c) in accordance with 513 372A
Repland	Brack	net A	- filter	Checked mutter ten cracks , work
Lachal	Enclas	Lubr	ica ted	all Controlls, Man of Sutistacion No
1.10	Tilte	nel roo	ke be	Lover Screws All AOA Checkerl and
Cul	92-1	14-15	Too	the that this Engine has been Inspected
C 1 7 7 1		11	0.00	Cover Screws All AO's Checked and the that this Engine has been Inspected I Inspection and was determined to be in 072608774 Ill a Hung End-
19 accordi	nie wi	the an	TA	10000 10 10 10 1 Ful-
an ainfu	the Co	nelities	LA	012608/19 2000
4/18/95	Tach	Time 10	00.8 To	tal Time 1673.4 Time since Overhaul 87.3.
Time sind	ce last	inspe	ction 2	21.6. Changed oil & filled sump with 8 Qts. ced oil filter and inspected it for
contamina	tion.	Inspec	ted oi	1 suction screen. Replaced air induction
filter. I	nspecte	ed fuel	scree	ns and gas collator for debris. Checked all

fuel & oil hoses for condition & tightness. Performed magneto timing test. Both mags timed @ 25 deg. BTDC. Cleaned fuel injectors and inspected injector lines for tightness and integrity. Performed compression test. Cyl #1 72/80-Cyl #2 72/80- Cyl #3 74/80- Cyl #4 74/80. Cleaned & gapped spark plugs. Inspected alternator & starter wiring & ignition harness. AD 93-02-05 (Fuel inj lines) complied with. Replaced oil return line from rocker box of #4 cyl to sump.

I certify that this aircraft has been inspected in accordance with a 100 hour inspection and found to be in an airworthy condition.

Bill J. Hoyt AP 376287285 4/18/95

> Bill 2 Hoyt END

and was determined to be in an airworthy condition IA072608774 Ilany

SUB-TOTALS this page

TOTALS-Carry forward to next page

Page No.

Total Time 1701.1 Time since Overhaul 115. Changed oil & filled sump with 8 Qts. Aero Shell 15W-50. Replaced oil filter and inspected it for contamination. Inspected oil suction screen. Replaced air induction filter. Inspected fuel screens and gas collator for debris. Checked all fuel & oil hoses for condition & tightness. Performed magneto timing test. Both mags timed @ 25 deg. BTDC. Cleaned fuel injectors and inspected injector lines for tightness and integrity. Performed compression test. Cyl #1 73/80-Cyl #2 75/80- Cyl #3 76/80- Cyl #4 75/80. Cleaned & gaped spark plugs. Inspected alternator & starter wiring & ignition harness. I certify that this aircraft has been inspected in accordance with a 100 hour inspection and found to be in an airworthy condition. Bill J. Hoyt AP 376287285 7/1/96

Bill 9 Hoyt Total Aircraft Tach Reading Engine Time I certify that is Engine has been inspected in ... with Ginney and was determine be in an airworthy condition

Tach Time 151.1 Engine Time (Total) 1723.7 Time Since Major overhaul 137.6 Time since annual

Changed oil & filled sump with 8 Qts. Aero Shell 15W-50. Replaced air induction filter with Brackett filter element BA-5705. Replaced oil filter element with Champion oil filter element CFO-100 element. Examined removed element & examined it for contamination. Found none. Inspected oil screen for foreign material. found none. Inspected oil cooler for security and condition. Inspected gascolator for foreign material. Found none. Inspected throttle body fuel screen. Performed compression check. Cyl #1 76/80, Cyl#2 78/80, Cyl#3 76/80, Cyl#4 77/80. Cleaned, gapped 6 rotated plugs. Replaced spark plug gaskets. Checked mag timing. OK (25 deg. BTC). Performed engine run-up and checked for leaks and operation. AD 94-14-22 (crankshaft gear) due at next overhaul or prop strike. AD 97-01-03 N/A. No cylinders were replaced after 12-15-95.

I certify that this engine has been inspected in accordance with a 100 hour inspection and found to be in an airworthy condition. Bill J. Hoyt ASP 376287285 7/14/97 Bill & Hoyt

Engine Time \$MOH /B 7 certify that this Aircraft I ngine has been inspected in accordance with Annual inspection setormined to be in an airworthy condition.

END

SUB-TOTALS this page

TOTALS-Carry forward to next page

DESCRIPTION OF WORK PERFORMED-Page No. SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK COR TOTAL NG TOTAL TIME TIME SINCE DATE OVERHAUL TOTALS brought forward from previous page SERVICE Tach Time 1827 Total Time 1755.3 Time since last annual 31.6 Checked magneto timing (both mags 25 deg BTC.)

Performed engine run up and checked for abnormal conditions, including prop operation. Performed compression check. Cyl #1 77/80; Cyl #2

Performed engine run up and checked for abnormal conditions, including prop operation. Performed compression check. Cyl #1 77/80; Cyl #2

Performed engine run up and checked for abnormal conditions, including prop operation. Performed compression check. Cyl #1 77/80; Cyl #2 Performed engine run up and enecked for abhoritant collection of the collection of t 76/80, Cyl #3 76/80, Cyl #4 76/80. All Ck. Replaced and Factors and Factors and Gapped spark plugs. Cleaned fuel injectors. Inspected prop for mcks, leaks, and cracks. C/W AD 08-14-07, next due @ 282.7 or 10/14/10. AD 05-12-06 (Bendix D2000 Impulse of Charles and Colors and coupling due @ 2086.1. AD 04 10 14 Due with prop strike or engine OH. I certify this engine to be in airworthy condition. B.J. Hoys AP# 376287285 Bill 7 Hoyl 10/14/09 DATE: 12/01/09 SWIFT AVIATION INC TACH: 179.3 121 OSWEGO RD PLEASANT VALLEY NY 12569 845-677-6736 PERFORMED DIFFERENTIAL COMPRESSION TEST 1) 77/80, 2) 76/80, 3) 76/80, 4) 76/80. CHECKED MAGNETO TIMING, INSPECTED EXHAUST. INSPECTED PROPELLER. C/W AD 2008-14-07 BY INSP OF FUEL INJECTION LINES. REPLACED AEROQUIP #303 (non-teflon) STYLE FUEL & OIL HOSES. INSTALLED REIFF ENGINE PRE-HEATER KIT. OTHER ROUTINE MAINTENANCE HAS BEEN ACCOMPLISHED AT THIS TIME. I CERTIFY THAT THIS ENGINE HAS BEEN INSPECTED IN ACCORDANCE WITH AN ANNUAL INSPECTION & HAS BEEN FOUND TO BE IN AIRWORTHY CONDITION WALTER T WIEMER A&P 97485363 IA 9-28-11 TACH 219.6 CHANGED ON & FILTER SERVICED
WITH AFRE SHELL 15-50 INSTALLED
ENGINE HOSE KIT PHT P/N CE 177
INV. 576341 GROWND RUNG CHECKE SUB-TOTALS this page TOTALS-Carry forward to next page

				Page No.
DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page
27-2012	1802.3	217.2	230.7	CHANGED ON & FUTER
	1			SERVICED WITH 8 DIS A/S
111	1 1	ļ.,		15,50, INTIANGO OHI GHANT
			\	545 Tan AWI WO# 144283
		73-	76	REPLACED INDUCTION AIR FILTER
		77-	976	ELENCOT BA 5705. REPLACED OIL
	1 1		80	COOLER OTLE FITTING BUSHING
		100	. 'Se '''	INSTALLED YH ENGINE DRIVEN FUEL
				Dump AN 41234 SN 810209
	T,	1	1	REPLACED SCAT TUBLIZ AS REQ -
				REPLACED THROTTLE & MINTURE CONTR
				RON GUM ALL ROUTINE
				LUZRICATION & SOURCING ACCOMPLISH
		-		SEE AN LUTY (-NULLAN AUN &
		3		CHECKEN
				I certify that this ENGINE
1 1			1	ith a how tinspection
				is in an airworthy conditie
				Ja 22359 47
		-		
5-21-13	1840.2	2541	267.6	
	~75	LA .	8	Cleaned + Tested spark Plus. Cleaned fuel injectors
	10	1	8	du AO 2011 - 26-04 Fuel injector lines. All routine Serving
7	- 10	0	0 .	Jubracation accomplished Greand runs leak + 905 checks good
		80		has been inspected in accordance
		certify that	this En	4th a 100hc inspection  1 is in an airworthy condition.  Conden:  Cares Ought 40064)
		th a AN	UAC insp	ection
		1 ts in an	airworthy o	142231111
	6			SUB-TOTALS this page
	1		13000	TOTALS—Carry forward to next page

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING	3 WORK
	1840.2	254.1	267.6	TOTALS brought forward from previous page	, ,
7-24-13	1884.0	297.9	311.4	Changed oil + filter, serviced w/	A/5 15W50
1 5 1 13	100		-	Filter = Cf0-100, 8 Quits Clean	# & Project
				Run-up - ops/cent check normal 1	1/438
				Nun-up of - / sen	
8-12-13		h .	363.8	Ran Envine and Drained oil. Installed	New
			33.0	Element pla Cfo-100. Serviced Engin	e W
-,11	2.12.2			8 QTS ISW-50. Installed New INTE	ike .
	1			GASKOS ON #2 3 #4 CYLS. P/N 719	73.
9	0.88		1	All lank And ons chock Fine ATTH.	5Timo
1				AH 2020	90
-		10.01		CA 3358711 43587	7
	Cleaned Checker Needed Function Replace Oil not of AD09-2: AD11-2: AD12-1: I certif	and gapped fuel syster Checked air Checked a Airfilter E changed at the 6-12 Titan of 6-04 Extern 3-06 fuel seriol. Cranksly that this	a spark plugs, in drained sum iternator or get dengine and BA5705 his time. Evylinder N/A i ala fuel inject rvo N/A by onaft N/A by dis aircraft en pection and	by S/N ion lines and clamps CW per SB342G, Due 06-2015/490.7 verhaul date	
and the second					
VILL BELGE					
				The state of the s	
	Laber				
	Law	Ne Na	1111		
Na Landy	Lave	The hold		Access to the transport of policy and	
No confi		Total	422	Table Mark to School and School a	
No control	L. D			SUB-TOTALS this page	

	TOTA			t Newport Airport 550 ,FAX 401-846-433			
DATE	SERVIC					LYCOMING IO-360-AF	B6D
				Г 2071.7 TSMOH 485.6		D1 00111110 10 200 111	
				spark plugs, checked co	ompression, #1-	74 #2- 72 #3- 76 #4- 74	-over
		80. Ch		drained summe and ince	nested Cleaned	all screens and gascolate	nr 90
						d magnetos and timing.	л из
		_ Fu	nctionally checke	d engine and systems.			
	1911		rviced with				
		AL AN	DIT-26-04 EXTER	RNAL FUEL INJECTO	R LINES. CW	BY INSPECTION OF LI	INES
		DI	JE EACH 100 HE	ES OR ANNHAL BAS	K IS PERFORN	MED ON LINES OR CLA R, 7 QTS OF 15W50, CI	AMPS H48103
	1 11 1	OI	L FILTER . TOO	K OIL SAMPLE, SEN	T TO AVIATIO	ON LABS. NEW VAC P	UMP
Recis	121 1	2 P/I	N 211CC FROM	HOLLY AREO WO# 22	2608. TIGHTER	N ALTERNATOR BRAC	CKET
100	Sex	AS	NEEDED. 1 NE	W SPARK PLUG RHM	138E. OIL FILT	ER COVERTER PLATE	E AND
	10.32	- G/	ASKET 54E23093	3. TORQUED CONVER	TER TO 60 FT	LBS	
- 4	10 C	Ic	ertify that this	aircraft engine has l	neen inspecte	d in accordance with	an
	5 11/114	an	mual inspection	n and determined to	he in airwort	hy condition	an
	1537	-		100	oc in an wort	ly condition.	
					2-00 2-	82899914	
		N/			0		
07 11		.					
2/100	20,	5	546.0	Changed oil	A Cil	for new	
			13 '	01 - 4	+ 011 11	2 1011	
	_	_		Champion -F	CH-48	103-1 tiller	
				7 Qts Shell	15-50-	FAA-344411	.3
				546,0 TA	6 537	C TSMOTH P/1	/
		1 20		1	11 1	1 211+	-
1				1162.0 41	5 /fobe	55 Give LAM.	brecht
- Engine	Logbook			gon Aircraft Service,		Authori	ized
	ntry		19 W	right Way, Fairfield, NJ 07 (973)575-0364 Fax (973)24	004	Cessna S	Service
- AMERICAN DE	ate	N' Number	Make/Model	and the same of th		Cent	A CALL
2/17	7/2016	N21930	IO-360-A1R6D	1 12202 514 550	C C C C C C C C C C C C C C C C C C C	Total Time W. C	
No oil ch	nange. Bore	econed cylinde	ore no defeate nates	Casal along the		2132.1 861: Magneto timing checked. #1	5
			laced all intake pipe ngine washed and ru		3 by repalcing fue	Magneto timing checked. #1 el servo plug gasket. C/W AI	D 15-09-
I certify	that this eng	ine has been	inspected in accord	un up cnecked OK. Iance with an Annual Inspe	oction nor EAD 4	3 Appendix D and determin	
		ondicion.					ied to
- I certify	that the wor	k described at	ove was performed	satisfactorily and in accord	fance with approv	/ed/acceptable data and is	
approve.	d for return zed Signati	to service with	regard to work peri	formed.			
-		ire:	146	w the	Steve Vand	ler Valk A&P 2919106 IA	
N219			3-19-2017	TACH: 704.3	The state of the s		
			ed screen-then service	ed with 8qts of 15w50 oil			
-High	itened altern:	ator belt in back line clan					
-Pert	Ormed Comr	roscion Chaple	1170/00 01	0	San T		Al Late
-msc	alled owner s	upplied M20 air	-oil separator per STC	ISAU203371/see form 227 f-	C 74		and the
-c/w	/ AD 2011-26	Od by viewel in	S	41B Group Poles L L C		Service Control	
				NUAL INSPECTION and found		A TOTAL OF THE PARTY OF THE PAR	
Rusty		- July collattion		Ioulu		- 5 1 1 1 1 1 1 1	
			70334IA		1		
					to next none		

Page No				
DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
				TOTALS brought forward from previous page
July 17		735	7486	BAN Engin drained oil installed new filter
,				Serviced 8 gts 15-50 Aeroshell, RAN
				checked ok A-Plt 3444113
2018				Hobbs 1991.7
Jan 28		775	788.7	RAN Engine, drained oil, Installed new
				New Champion CH48103, 8 quarts of
				15-50 Acroshell, Ran Checker OKAY
				Hobbs 2036.2 2+7/ 3444113
	į,		4	
5-1-18		THE STATE		
		Con	cord Aviation Se	ervices 71 Airport Rd Concord NH 03301 603-229-1769
	1	N2193Q Engir	te log 5/1/2018	793.9 Tach 680.4 TSMOH WO 18-5732
	100	Drain engine o	il	for inspection and found normal
		Install a new o Clean sump scr	il filter PN Temp	pest AA48110-2
		Refill engine w	ith 8 quarts of P	hillips 20w/50 XC oil
7		Service fuel ser Clean and re-ga	p sparkplugs	
		Check magneto Replace # 2 c	timing ylinder with an o	overhauled cylinder from Gibson Aviation PN 74497
		SN 108419 wit	h newygaskets ar ge ryn-up satisfa	nd seals
		1111	Muse	law.
10		Mile	1 1/19	
		Richard Meyers	A&P 1537483	
		Concord Avia	ation Services 7:	1 Airport Rd Concord NH 03301
			Tach:	793.04 - RETH: 680.4
1,2		i certify that	this E	78/WE has been inspected in
		accordance	mnual	inspection and was determined to be in
			condition. ers IA 153748	
0.1.1.0		Richard Mey	WIS IN 135746#	
.8 NOU 2	ગાય	TACh	Time	824.0 Hubbs 2079, 2 RAN Engage
		Draine	01/1	Installed New CH48103 Champion Fifter, 7 Q
		cil 15.	50 Ae	10 stell. RAN Chacked olary. It Plan
	1			SUB-TOTALS this page 3444113
an .		810,51	# 1	TOTALS—Carry forward to next page
	]/	Smult]		
		3 11011	l	

DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
		de la constant de la		TOTALS brought forward from previous page
			71 Airport 603-229-1 N2193Q - PERFOR #3 77/80 - Changed Filled sur and safet - Services - Serviced - CW AD 2	Engine 05/28/19 Tach: 848.0 ENGTT: 734.5 WO# 5921  IMED COMPRESSION CHECK, results: #1 77/80, #2 78/80, #4 77/80  iol & filter, cut spart filter and inspected for foreign material, found normal, np with 7 qts Aeroshell 15/W50 oil, install new oil filter P/N AA48103-2 wired.  ump screen and install new gasket P/N MS35769-21. fulci intel filter and install new o-ings P/N 951789 and 953541-10.  105-19-07 Fuel injector line visual inspection OK.
			Richard M	ag lulling. ON. egglorfund maint run up ops and filter leak check OK. eyers A&P 1537483
			<u></u>	Concord Aviation Services 71 Airport Rd Concord NH 03301
	`,		Dat	rsify that this \$19 Mer has been inspected in accordance haln) this thing the first thing the
			wit an:	inspection and was determined to be in inspection and was determined to be in inspection. I was a serial was
		40 N2	1-846-4550. 193Q CESSNA	Inc Newport Airport 211 Access Rd Middletown RI 02842 Cell 401-418-0335. Email chrisaircraftine@AOL.com  177RG SAN17RG60593 TACH 879.0  RAINED OIL. SERVICED WITH 8 OTS AEROSHELL 15W-50 1 CH48103-1 OIL FILTER TER COMPLETION OF WORK NO LEAKS FOUND AT THIS TIME.  APP 2038599
- V.				
			agent he	SUB-TOTALS this page  TOTALS—Carry forward to next page

DATE	TOTAL TIME IN	3	WORK
	SERVICE		
		1100	
		Concord Aviation Services 71 Airport Rd Concord NH	
		603-229-1769	
		N2193O Engine 07/09/20 Tach: 888.4 ENGT: 774.5	
		PERFORMED COMPRESSION CHECK, results: #1 77/80, #2 78/80,	
		#3 77/80, #4 77/80.	
		and install new gasket P/N M535/69-21. Remissions the	
		Check mag timing OK Clean and rotate spark plugs.	
		Clean and rotate spark plugs.     Serviced servo fuel inlet screen and install new o-rings P/N 951789 and 953541-10.     CW AD 2015-19-07 Fuel injector line visual inspection OK.	
		- Linstall new drainbackfube PIN APS-72703 on #2 cylinder Post inspection and naint you ops and filter leak check OK.	
		111111111111111111111111111111111111111	
		Richard Meyers ASP/IA 1531485	
		Concord Aviation Services 71 Airport Rd Concord NH 03301 603-229-1769	
		Date: 2-9-20 Tach: 888,4 - 1520 - 174.9	
		I certify that this Engine Las been inspected in	
		accordance with a(n) ATINU Ad inspegtion and was determined to be in	
		with 6(n) 1771/12 reg (hypergraphic was determined an almorthy condition.  Richard Meyers IA 1537483 Publish Mbs. (1988)	
		nichara meyers in 1337403 y	
-			
N210	OSO Caccos	177RG S/N 177RG0593 04/1	0/2021
14213	)JQ CE33110	17710 0711 17710 0000	
TACH	894.4		
-		0 440CD C. WIL 42202 F1A	Ī
Lycon	ming 10-36	0-A1B6D Ser# L-12393-51A	_
TTSM	10 894.4		
		s been inspected in accordance FAR 43 Appendix D during an ANNUAL Inspection.	
		oil, inspected oil screen. Serviced engine with 7 quarts of Areoshell W100 oil. Insp	
magn	eto timing	. Post run and leak check satisfactory. Cylinder compressions as follows #1 76/80 #	12
77/80	3# 77/80	#4 78/80 I certify that this E.NGINE was inspected during an ANNUAL inspection	and
found	to be airw	vorthy at this time.	
_		M \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	1
Grego	ory J. Rupp	Certificate Number 3051738IA	
-	V 5 10 10 10 10 10 10 10 10 10 10 10 10 10		
1.5			A
		SUB-TOTALS this page	
Г		TOTALS—Carry forward to next page	

				Page No
DATE	TOTAL TIME IN SERVICE	TOTAL TIME SINCE OVERHAUL	TACH OR RECORDING METER TIME	DESCRIPTION OF WORK PERFORMED— SIGNATURE & CERTIFICATE NO. OF PERSON PERFORMING WORK
10 Jul	Hope		2183,5	TOTALS brought forward from previous page
,		899.0	912.0	RAN Eigene druned oil Serviced W 8 quarts Stell 100 mireral oil Change CH49103 oil filter Eigene Ran, No lenks. All 3444113 miss
				Stell 100 mineral oil change CH49103 oil
				filter Engine Ran, No leats HALL Zene lambon
				1 1
				1 1 1 1
				3 1 2 1
				SUB-TOTALS this page
ſ			1550 AT.	TOTALS—Carry forward to next page