

Propeller Log Book ^{#1}

N34904 PROP LOG

FULL
SEE BOOK #2

INC.

Located At
7244 Robert Cardinal Airport
Municipal Airport
Tuscaloosa, AL 35401

FAA Approved Repair Station
AZER344C

(205) 345-4100
1-800-398-PROP

24
Friedrich Schlegel
Book

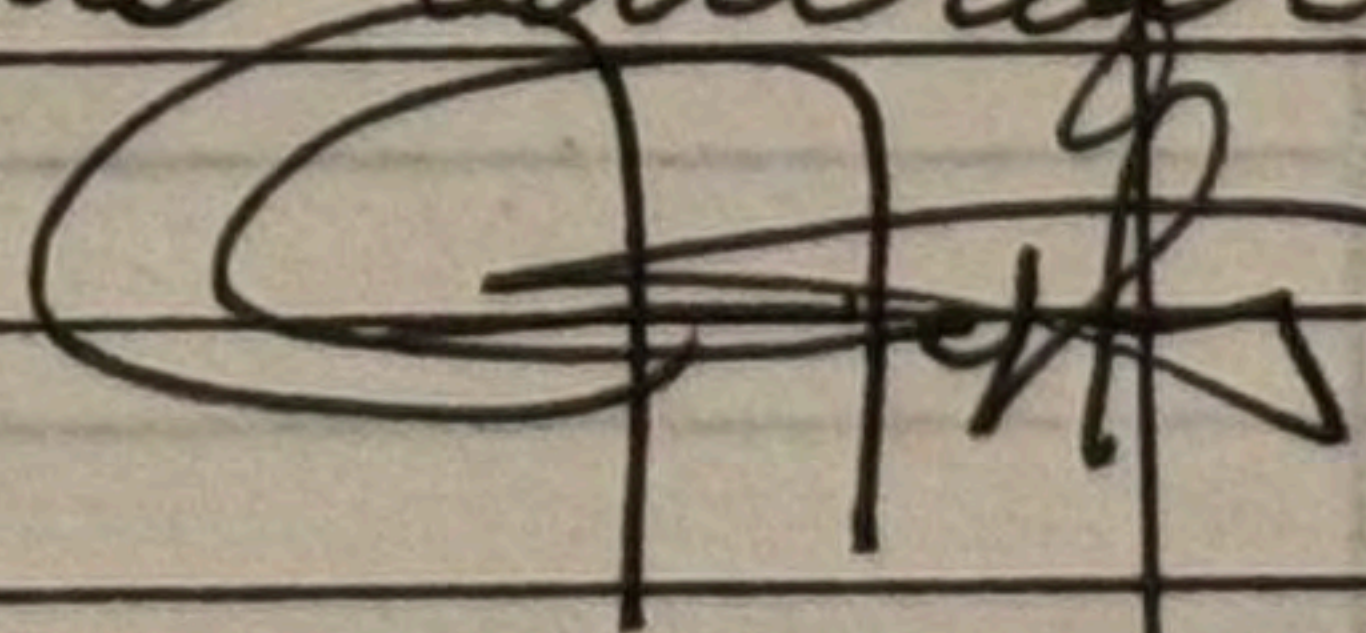
**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
07/14/97		I CERTIFY THIS PROPELLER HAS BEEN OVERHAULED SERVICE MANUAL NO. 780630 AND FOUND TO BE IN AN AIRWORTHY CONDITION. PERTINENT DETAILS ARE ON FILE UNDER WO# 4385 AT REPAIR STATION AZER344C APPROVED FOR SERVICE	
		C/W	
		SB thru 192A	
		S.L thru 93-15	
		PRECISION PROPELLER SERVICE, INC.	
		7244 Robert Cardinal Airport Rd.	
		JUSCALOOSA, AL 35401	
		(205) 345-4100	

CHADWICK VER
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
7/15/97	TACH 3229.0	THIS PROP INSTALLED ON N34904 CESSNA 177 AFTER OVERHAUL. PROP BOLTS TORQUED AS PER 177 MAINT MANUAL.	M. H. BOWERING AP 1707558 <i>M. H. Bowering</i>
10/7/97	Tach 3265.1	New Tach Time .0 hrs. Remove tach : Install New Tachometer P/N 01-112-5025 Serial # 7423 M. H. Bowering A: P 1707558	

**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
12-15-97	18.1	Dynamic Balanced & Vibration Spectrum Tracked this A/c Spinner - Propeller - Engine Comb. as per "specs", set forth in "Smooth Propeller", pub. # AW 9511-2 by Chadwick Helmut	
Model 192A		Initial Imbalance: .49 IPS. Balance R.P.M.'s: 2358 (Actual). Static Wts: Blade # 2-1 #	
Calibrated 8/97		B-4828 M ^c Cauley bracket. Wt. Pkg: 35.3 grams of A/c approved hardware installed @ 6.5" Radius, countersunk on the lip of the spinner bulkhead with Hub 5/8 @ 12:00 & wt. pkg. @ 7:50 (Pilot's View). Confirmation Run: .01 IPS (Max. Power). This Aircraft returned to service. - END -	
			 A&P 428682644

**DESCRIPTION OF ALL OPERATIONS
PERTAINING TO AIRWORTHINESS DIRECTIVES,
SERVICE BULLETINS, SERVICE LETTERS,
& MINOR ADJUSTMENTS**

DATE	TACH TIME	DESCRIPTION OF WORK	SIGNATURE
5.25.99	156.5	This prop inspected in accordance with an annual inspection & returned to service	M.H. Bowring
			A+P 17075587 A.A.

N34904 N34904 PROP LOG ENTRY 6-7-2000 TAC TIME 297.2
PROP TIME SINCE OVERHAUL 343.3
COMPLIED WITH ANNUAL INSPECTION OF PROPELLER
David Townes Cox IA 587768674

Daniel Zou Zep

✈ AERO JACKSON ✈
N34904 PROP LOG ENTRY 6-26-01 TACH 439.1
PROP TT SINCE O/H 475.2
COMPLIED ANNUAL INSPECTION ON PROPELLER

David Townes Cox LA 587768674

Dart Lane Top

→ AERO JACKSON →
N34904 PROP LOG ENTRY 7-2-02 TAC 573.9
PROP TT SINCE O/H 610.0
COMPLIED WITH ANNUAL INSPECTION ON PROPELLER

David Townes Cox IA 2679578

David Zep

→ AERO JACKSON →
6-27-03 PROP LOG ENTRY N34904 TAC TIME 702.6
PROP TT SINCE O/H 738.7
COMPLIED WITH ANNUAL INSPECTION ON PROPELLER

David Townes Cox IA 2679578

David Zep

→ AERO JACKSON →
N34904 PROP LOG ENTRY 7-20-04 TAC 785.1
PROP TT SINCE O/H 821.2
COMPLIED WITH ANNUAL INSPECTION ON PROPELLER

David Townes Cox IA 2679578

David Zep

→ AERO JACKSON →
N 34904 PROP LOG ENTRY 5-25-05 TAC 848.9
PIROP TOTAL TIME SINCE O/H 885.0
PIROP REMOVED. REINSTALLED WITH NEW SEAL ON
O VERHAULED ENGINE.
COMPLIED WITH ANNUAL INSPECTION ON PROPELLER

David Townes Cox IA 2679578

David Zep

→ AERO JACKSON →
N34904 PROP LOG ENTRY 6-13-06 TAC 951.3
PROPELLER TOTAL TIME SINCE O/H 987.4
COMPLIED WITH ANNUAL INSPECTION ON PROPELLER

David Townes Cox IA 2679578

David Townes Cox

DATE

→ AERO JACKSON →
N34904 PROP LOG ENTRY 7-11-07 TAC 1053.8
PROPELLER TOTAL TIME SINCE O/H 1089.9
COMPLIED WITH ANNUAL INSPECTION ON PROPELLER

David Townes Cox IA 2679578

David Townes Cox

JACOBS AIRCRAFT COMPANY / JACKSON, MS
530 TERMINAL DRIVE 39209 / 601 948 1601

N34904 PROPELLER LOGBOOK ENTRY 8-6-08 TACH TIME 1209.3
PROPELLER TOTAL TIME SINCE OVERHAUL 1245.4.

I certify that this PROPELLER has been inspected in accordance with an ANNUAL INSPECTION and
was determined to be in airworthy condition.

David Townes Cox IA 2679578

David Townes Cox

JACOBS AIRCRAFT COMPANY / JACKSON, MS

N34904 PROPELLER LOGBOOK ENTRY 8-27-09 TACH TIME 1319.9
PROPELLER TOTAL TIME SINCE OVERHAUL 1356.0.

I certify that this PROPELLER has been inspected in accordance with an ANNUAL INSPECTION and
was determined to be in airworthy condition.

David Townes Cox IA 2679578

David Townes Cox

SERVICES OFFERED

- ★ Complete Overhaul
- ★ Repairs
- ★ Blade Straightening
- ★ Eddy Current Testing
- ★ Magnetix
- ★ Anodizing
- ★ Shot Peening
- ★ Cadmium Plating
- ★ Blade Shank Polishing
- ★ Static & Dynamic Balancing
- ★ Pick-up & Delivery
- ★ Remove & Install
- ★ Hangar Space Available for
- ★ Fly In's

214-240-1100

SERVICES OFFERED

- ☆ Complete Overhauls
- ☆ Repairs
- ☆ Blade Straightening
- ☆ Eddy Current Testing
- ☆ Magnaflux
- ☆ Anodizing
- ☆ Shot Peening
- ☆ Cadmium Plating
- ☆ Blade Shank Rolling
- ☆ Static & Dynamic Balancing
- ☆ Pick-up & Delivery
- ☆ Remove & Install
- ☆ Hangar Space Available For
- ☆ Fly In's

A FULL SERVICE PROPELLER SHOP

We Provide **FULL WARRANTY**
800 Hours or 1 Year

HARTZELL, McCAULEY
SENSENICH, BEECH HAMILTON
STANDARD